


19-7534



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200
Fax 613 632-5246

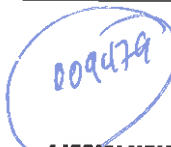

D212-664-101
Job Sheet 191405



Part No: D212-664-101

Job Qty: 1 ea

Part Name: Fwd Crosstube - High



Part Weight: 0 lbs

Status: New

Priority: Medium

Job Created: 2/28/19

Job Tracking No:

Due Date: 4/4/19

Created By: Marie Lajeunesse

Type: Stock

Description:

Note: D212-664-141 REV E/ IIN-D212-664 REV.J IPP Rev:E 04.02.16 Reformat KJ/DS IPP Rev:F 06-03-29 Remove
Comments on Pick List JLM IPP Rev:G 07-04-30 As per Rev C JLM IPP Rev:H 11.04.26 inspection strip ecn 11-
549 EC verf by:DD IPP REV:I 14.05.27 AS PER ECN 14-570 DD VERF:JLM

Ship Via:

Bill of Materials



Dart Aerospace Ltd.
1270 Aberdeen Street
Hawkesbury, ON K6A 1K7
CANADA
TEL.: 1 813 632-5200
Email: sales@dartaero.com
www.dartaerospace.com

Container No: S162585



Part: D212-664-101

Job No: 191405

Serial No/Batch: S162585

Revision: E/J

Inspector:

Exp Date:

Instructions: TC STC SH01-9 Issue 3, EASA STC SR01298NY 09/01/08, EASA ST

P.T.O.

Job Routing									
Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier		Sign-off
					Setup Hrs	Run Hrs	Workcenter / Supplier	Lead Time	
90	Start up Operation	1 Ea		4/4/19	0.00	0.00	Start Up Stores/Pkg-1		GP 19-03-19.
110	Packaging	1 pcs		4/4/19	0.00	0.00	Packaging1-3		GP 19-03-19.
120	CNC Bend Crosstubes	1 pcs		4/4/19	3.11	2.22	CNC Bend Crosstube		GP 19-03-19.
130	QC	1 pcs		4/4/19	0.00	0.00	QC15		MAR 19 2019
140	Crosstubes	1 pcs		4/4/19	0.00	0.67	Crosstubes-1		GP 19-03-19.
150	HandFXtube	1 pcs		4/4/19	0.00	0.98	HandFinish5		GP 19-03-19.
160	QC	1 pcs		4/4/19	0.00	0.00	QC7-1		MAR 27 2019
165	QC	1 pcs		4/4/19	0.00	0.00	QC5		MAR 27 2019
170	Outsource	1 pcs		4/4/19			SKY002-VC P/0043007		MAR 28 2019
180	Packaging	1 pcs		4/4/19	0.00	0.00	Packaging2		MAR 29 2019
190	QC	1 pcs		4/4/19	0.00	0.00	QC5		APR 02 2019
200	SprayPaint	1 pcs		4/4/19	0.00	0.25	Spray Paint		APR 19-4-22
210	QC	1 pcs		4/4/19	0.00	0.00	QC14		APR 26 2019
220	Crosstubes	1 pcs		4/4/19	0.00	1.69	Crosstubes-1		APR 19-4-22
230	QC	1 pcs		4/4/19	0.00	0.00	QC5		APR 26 2019
240	Packaging	1 pcs		4/4/19	0.00	0.00	Packaging1-3		APR 26 2019
250	QC	1 pcs		4/4/19	0.00	0.00	QC4		APR 29 2019
260	Packaging	1 pcs		4/4/19	0.00	0.00	Packaging3-1		APR 29 2019
265	DC	1 pcs		4/4/19	0.00	0.00	DC		APR 29 2019
270	QC21-FG	1 Ea		4/4/19	0.00	0.00	QC21		APR 29 2019

Part Op 120 - Bend tube as per Dwg D212-664-141 using CNC bender program 212-fw and Folio D212-664-101

Descriptions: 140 - "1-Drill pilot holes in tube as per Dwg D212-664-141 using drill Jig DT8548 & DT8549, using drill table DT8577, set-up towers in hole #7 as per QSI 10 2-Ream hole to finish size in tube as per Dwg D212-664-141 using drill Jig DT8548 & DT8549. Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes. 3-Scribe part # and batch # using vibrating stylus as per Dwg D212-664-141 4-*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D212-664-141"

150 - ***IMMEDIATELY AFTER GRINDING***

170 - *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Liquid Penetrant Inspection as per QSI 038 LPI as per ASTM 1417 Level 2 Attach copy of NDT results to work order

180 - Ensure copy of NDT results attached to work order.

190 - *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Inspect for damage & ensure results are as per Dwg D212-664-141

200 - *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** 1-Prime inside & outside crosstube as per QSI 005 4.2 BATCH: 5143304 2- After painting remove masking and apply matte clear coat per QSI005 4.2 3- MASK UNDERSIDE OF CROSSTUBE AS SHOWN ON DWG BEFORE PAINTING 4 -Paint Outside of Tube as per Dart QSI 005 4.2 clear 138875 paint 3155827

210 - Then, Wrap in plastic bag to protect from scratches

220 - *****LAY DOWN CROSSTUBE ON TABLE AND PUT DT10302 PINS IN SADDLE HOLE FACING UP, USE HOLE IN TAPE MESURE TO PUT IN PINS FOR LOCATING CENTER OF CROSSTUBE. ***** 1- Abrade mating surfaces of support and crosstube with 180 grit sandpaper, clean the area with MEK or equivalent as per dwg 2- Install supports with Proseal 890 per D212-664-141 and QSI 015 A/R Proseal 890 Batch: 5146194 EXP: 19-10 PROSEAL CURE TIME 72 HOURS: Start: 19-4-23 Finish: 19-4-26 3- Install clamps with rubber cushion (ENSURE CLAMPS ARE INSTALL ON TOP SIDE OF CROSSTUBE) using DT9565 as per Dwg D212-664-141. ***Torque all clamps to 80-100 IN-LBS.***

230 - ***RE-CHECK TORCQUE ON CLAMP AFTER PROSEAL HAS CURED FOR 72HOURS AS PER DWG.***

250 - ***VERIFY BY _____ BATCH # TO MATCH W/O _____

260 - Identify and pack for shipping as per PPP D212-664-101 Location : FG094

265 - Photocopy bluefile and create labels as per PPP D212-664-101 CHG006

Job BOM

Part / Item	Component Name	Quantity	Operation	Container
D212-664-101TRN	Crosstube Turning Detail	1 pcs (1 ea)	90-Start up Operation	5154711
D2893-1	Support	2 pcs (2 ea)	220-Crosstubes	
D3595-063-450	Rubber Cushion 0.63" Wide X 4.50" Long	4 pcs (4 ea)	220-Crosstubes	
MS21920-25	Clamp	4 Ea (4 ea)	220-Crosstubes	
AN6-35A	Bolt	4 Ea (4 ea)	240-Packaging	5123681
AN6-36A	Bolt	4 Ea (4 ea)	240-Packaging	5038752
D3428-1	Placard	1 pcs (1 ea)	240-Packaging	5112841
MS21042L6	Nut	6 Ea (6 ea)	240-Packaging	5149112
NAS1149D0663J	Washer	18 Ea (18 ea)	240-Packaging	5093705

Job Allocations

Operation	Component Part	Required	Inventory	Allocated
90-Start up Operation	D212-664-101TRN	1	4	0
220-Crosstubes	D2893-1	2 5167970	9	0
	D3595-063-450	4 5127835	70	0
	MS21920-25	4 5142136	155	0
240-Packaging	AN6-35A	4	83	0
	AN6-36A	4	52	0
	D3428-1	1	39	0
	MS21042L6	6	338	0
	NAS1149D0663J	18	870	0


Part Specifications

Specifications could not be found.

Plex 2/28/19 10:01 AM Dart.lajeunesse.marie

DART AEROSPACE LTD		Work Order:	191405
Description: Crosstube High Fwd (205/212/412)		Part Number:	D212-664-101
Inspection Dwg: D212-664-141	Rev: E		Page 1 of 1

Required Dimension	Min	Max
Height	26.67	27.17
1/2 Span	53.59	53.85
Angle	49	52
Total Span	107.18	107.7
Bending Passes	3	--
Crushing	--	7.2%

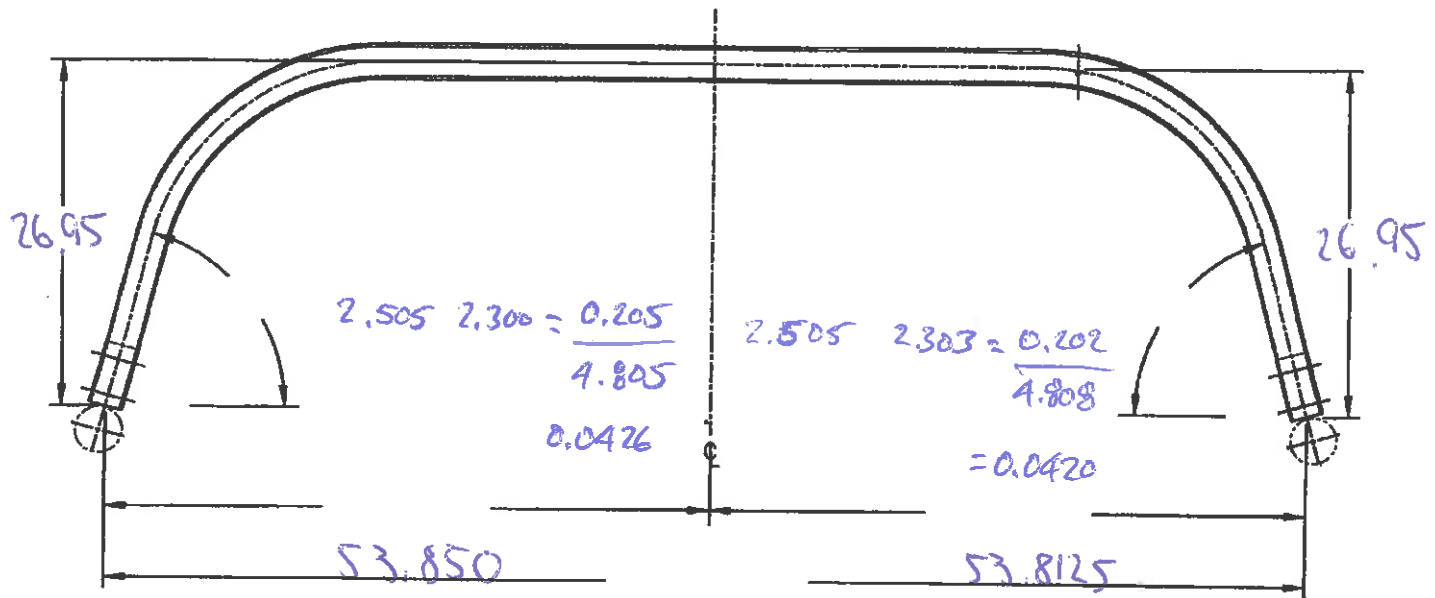

	Side A	Side B
Bending Passes	4	4
Crushing	4.3%	4.2%
Comments		

QC15 Inspection	DAS
Date	MAR 14 2019
	68
	9-89

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	08.04.21	Dwg Rev updated	KJ/JM	
C	10.04.01	Dwg Rev updated	KJ	
D	12.04.16	Added bending, crushing dimensions	KJ	
E	14.07.28	Revised max crushing %	KJ	
F	16.01.15	Revised Height min/max dimensions	KJ	

Item	Qty -141	Qty -141B	Qty -141F	Part Number	Description
1	X			D212-884-141	CROSSTUBE ASSEMBLY (205/212/412 HIGH FWD)
2		X		D212-884-141B	CROSSTUBE ASSEMBLY (214 HIGH FWD)
3			X	D212-884-141F	CROSSTUBE ASSEMBLY (208/212/412 HIGH FWD) (ANODIZED)
4	1	1	1	D6005-128	CROSSTUBE
5	2		2	D2893-1	SUPPORT
6	4	4	4	D3595-063-450	RUBBER CUSHION
7		2		D5017-1	SUPPORT
8	4	4	4	MS21920-25	CLAMP (OR MS21920-28)
9	A/R	A/R	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8902 CLASS B-2

GENERAL NOTES:

- MATERIAL: MANUFACTURED FROM D6005-128
FINISHED LENGTH = 126.514±0.020
 - FINISH -141 & -141B: a) CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
b) PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
c) MASK UNDERSIDE OF CROSSTUBE AS SHOWN (ZN C8-2 / C8-3, HATCHED AREA)
d) PAINT OUTSIDE PER DART QSI 005 4.2
e) REMOVE MASKING AND APPLY MATTE CLEAR COAT
 - FINISH -141F: a) ANODIZE PER MIL-A-8825, TYPE II, CLASS 1.
b) ALODINE (DO NOT ETCH) PER QSI 005 4.1.2
c) PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
d) MASK UNDERSIDE OF CROSSTUBE AS SHOWN (ZN C8-2 / C8-3, HATCHED AREA)
e) PAINT OUTSIDE PER DART QSI 005 4.2
f) REMOVE MASKING AND APPLY MATTE CLEAR COAT
- *NOTE:** BETWEEN FINISHING OPERATIONS EXTREME CARE MUST BE TAKEN NOT TO CONTAMINATE OR DAMAGE FINISHED SURFACES.
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
 - UNITS: INCHES UNLESS OTHERWISE NOTED.
 - BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
 - IDENTIFICATION: SCRIBE DART PART NUMBER "D212-884-XXX" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS
 - WEIGHT: D212-884-141/-141B/-141F = 33.8 lbs
 - PART IS SYMMETRIC ABOUT CENTERLINE.
 - EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.

MACHINING

- RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.

BENDING

- BEND PROGRESSIVELY WITH A MINIMUM OF 3 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 7.2% (BASED ON O.D.) IN LOWER HALF OF R35.5 BEND AND 6% (BASED ON O.D.) ON REMAINING TUBE.
- LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.

ASSEMBLY

- TO INSTALL D2893-1 / D5017-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8902 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- INSTALL MS21920-25 CLAMPS (OR -28) WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE ON TOP SIDE OF CROSSTUBE.
- TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT

WITHOUT NOTICE
WORK ORDER

NO. 191405 415

19-02-28

RELEASED
2014-05-26
WD

E	ADD -141F. D5017-1 WAS D2893-1 (-141B). PROSEAL WAS MAGNOBOND, NOTE 2: ADD INSPECTION WINDOW, NOTE 11: ALLOW 7.2% CRUSH, NOTE 15: ADD 72HR CURE AND RETORQUE FOR PROSEAL, ADD SHEET 3, CLAMPS REVERSED TO PREVENT CHIPPING (B7-2, B7-3), BEND HEIGHT TOL. NOW 0.25 WAS 0.13 (C1-3), INCORP. DEC 0-1/2-3	CP	14.04.01
D	REFORMAT/REVISE GENERAL NOTES/PART LIST; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; ADD -141B (ZN B4-2, D4-2); REMOVED REF & ADD TOLERANCES (ZN B4-3, C8-3 & B8-3); RELOCATED FLAG #8 PER PAR 08-048 (ZN A5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4	RF	08.09.30
C	REMOVE -881 ABRASION STRIP; ADD MAGNOBOND 6396, CUSHION, REVERSE CLAMPS	PH	07.03.08
B	ADD HOLES FOR COMPATIBILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	CP	00.12.12
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	14.04.01		
DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA DRAWING NO. D212-884-141 SHEET 1 OF 5 TITLE XTUBE ASS'Y (205/212/412 HI FWD) SCALE NTS COPYRIGHT © 2005 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

8 7 6 5 4 3 2 1

13 14 15
D2893-1 SUPPORT
MS21920-25 CLAMP, 2X
D3595-083-450 RUBBER CUSHION, 2X
2 PL

14.00

D212-664-501
BENT TUBE

2.0
1.0


MASK AREA PRIOR TO PAINTING,
REMOVE MASKING AFTER PAINT
AND APPLY CLEAR COAT

2.0

CL
SYM

D212-664-141/-141F
ASSEMBLY DETAIL


RELEASED
2014-05-26
AND

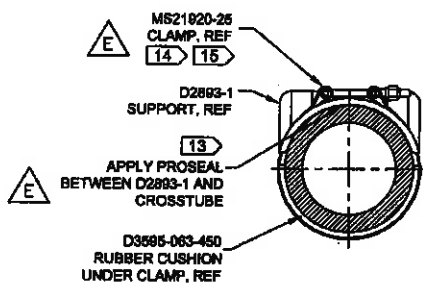


SECTION A-A
SCALE 4X

DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESSBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. E
MFG. APPR.		D212-664-141	SHEET 2 OF 5
APPROVED		TITLE	SCALE
DE APPR.		XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	14.04.01	COPYRIGHT © 2006 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE REPRODUCED OR COPIED OR TRANSMITTED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

8 7 6 5 4 3 2 1

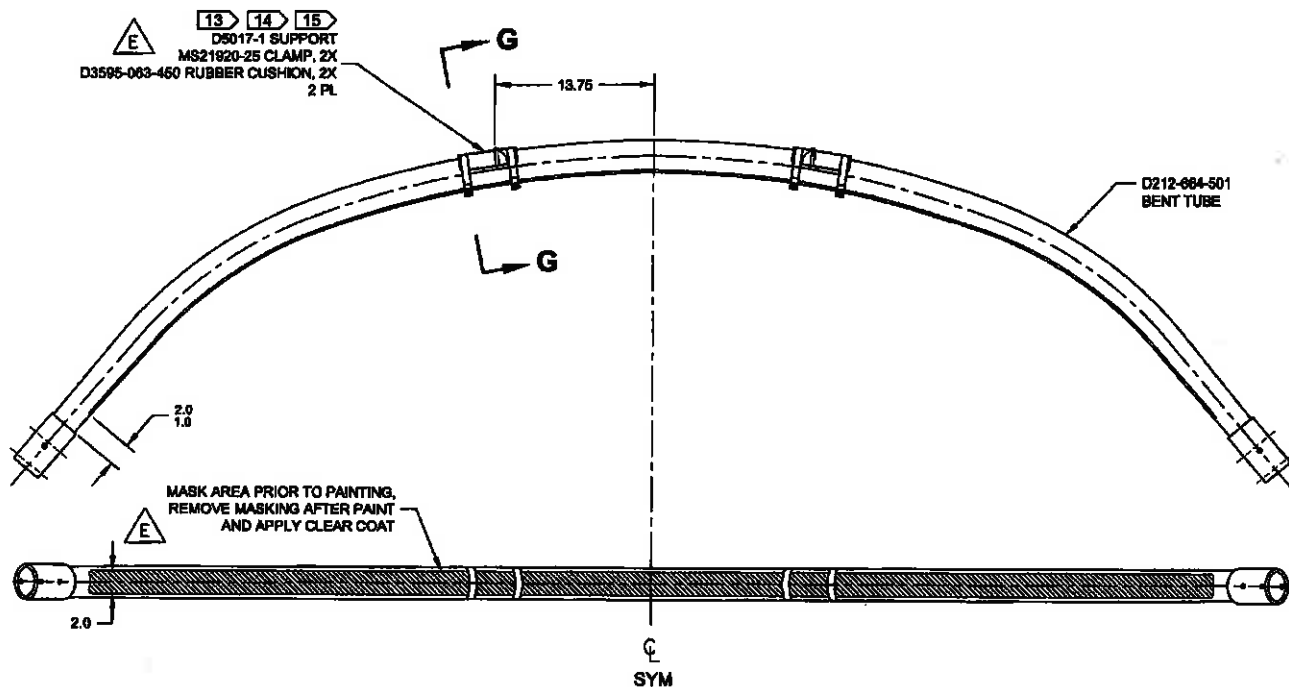


**D212-664-141B
ASSEMBLY DETAIL**

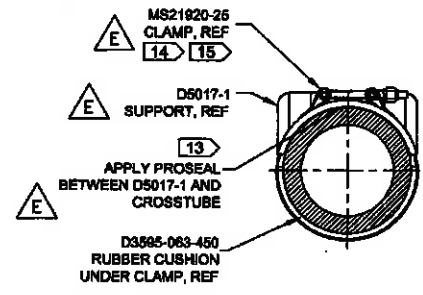


**SECTION G-G
SCALE 4X**

RELEASED
2014-05-26


DESIGN	P	DART AEROSPACE LTD	
DRAWN	P	HAWKESSBURY, ONTARIO, CANADA	
CHECKED	DL	DRAWING NO.	REV. E
MFG. APPR.		D212-664-141	SHEET 3 OF 6
APPROVED	HL	TITLE	SCALE
DE APPR.		XTUBE ASS'Y (205/212/412 HI FWD)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DRAWING IS A DESIGN AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

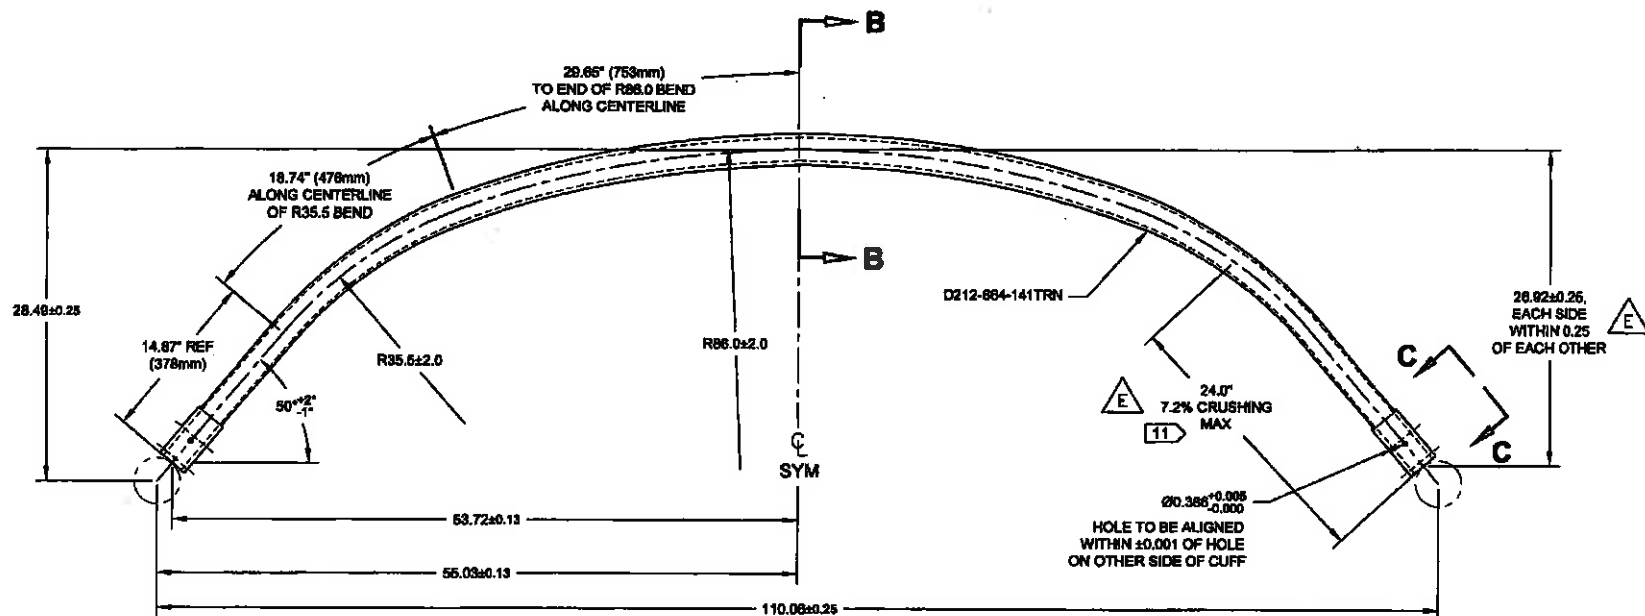

D212-864-501
BENDING AND DRILLING DETAIL 11

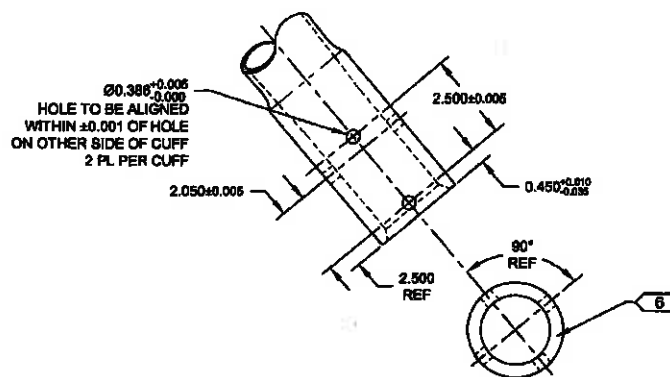


VIEW C-C: CUFF DETAIL
SCALE 3X

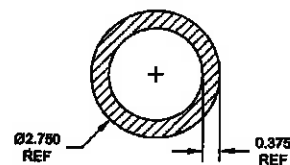

SECTION B-B
SCALE 4X

RELEASED
2014-05-26

DESIGN	92	DART AEROSPACE LTD	
DRAWN	92	HAWKESBURY, ONTARIO, CANADA	
CHECKED	92	DRAWING NO.	REV. E
MFG. APPR.	92	D212-864-141	SHEET 4 OF 5
APPROVED	92	TITLE	SCALE
DE APPR.	92	XTUBE ASSY (205/212/412 HI FWD)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD	

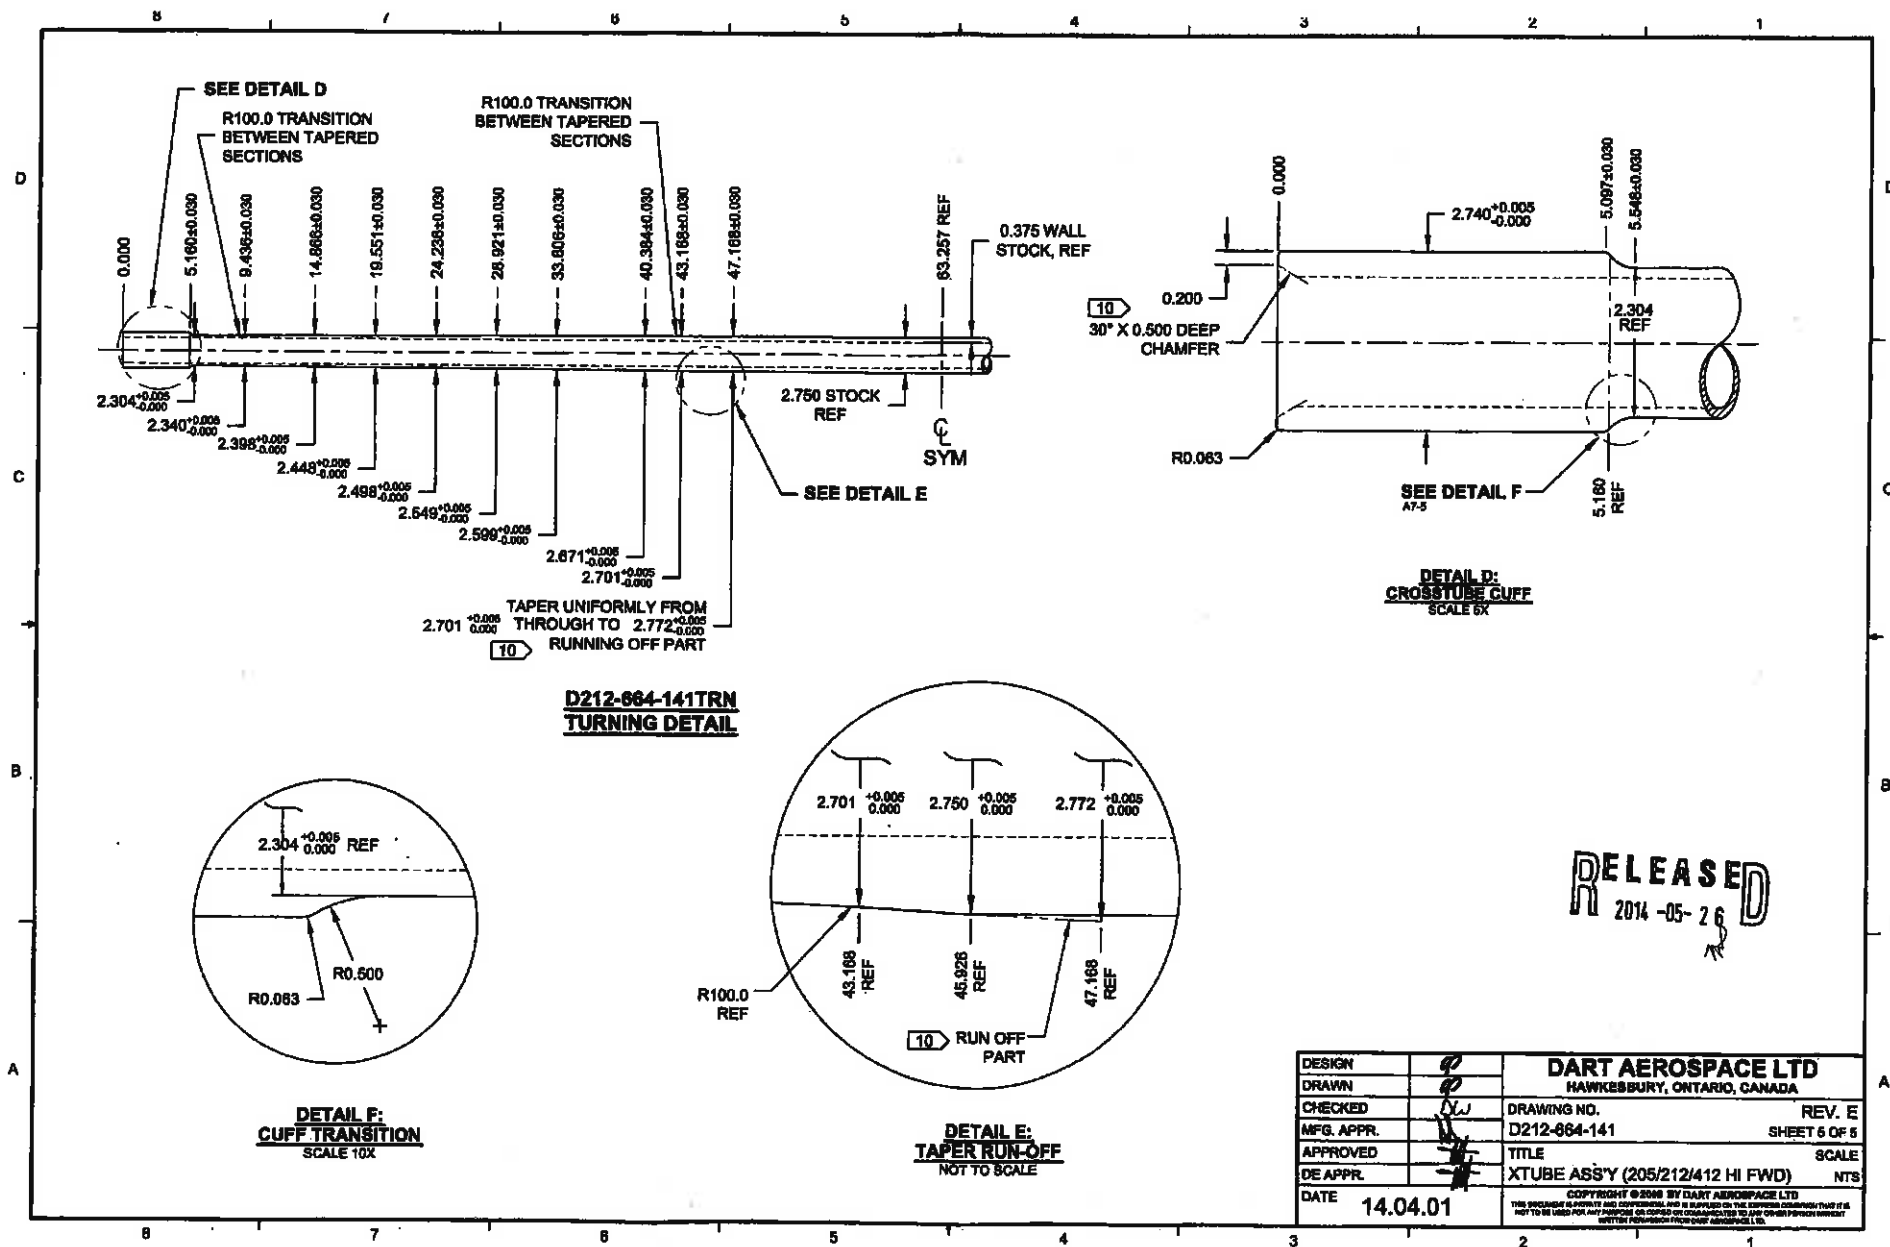



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

PURCHASE ORDER

PO043007



Supplier: SKY002-VC
Skyservice
6120 Midfield Road
Mississauga
ON
L5P 1B1 Canada
Phone: 905-678-5636
Fax: 905-678-5841

Attention: Jenne, Heather

Ship To: 1270 Aberdeen Street
Hawkesbury
ON
K6A 1K7 Canada
Phone: 613-632-5200

PO No: PO043007

PO Date: 3/28/19

Due Date: 3/29/19

Purchase Order

Revision:

Revision Date:

Ship-To Contact: Phone:

MAR 28 2019

Via: Ground

Pymt Terms: Net 30

Freight Terms:

Special Comments:

Items

Line Item	Job	Part	Description	Status	Account	Due Date	Order Quantity	Received Quantity	Balance	Unit Price (CAD)	Extended Price
1	184180	D4464-041	Fuel Tank Assembly : Various STC's ISSUE P/O LIQUID PENETRANT INSPECTION AS PER QSI 038 OR LPI AS PER ASTM 1417 LEVEL 2	Firmed	-	3/29/19	1 pcs	0 pcs	1 pcs	\$198.33333/pcs	\$198.33
2	190172	D212-664-201	Aft Crosstube - High : TC STC SH01-9 Issue 3, FAA STC SR01298NY 09/01/08, EASA STC EASA.IM.R.S.01304 07/03/06, DGAC MEXICO STC IA-316/2015 15/06/17 ***WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE.*** Issue P/O: LIQUID PENETRANT INSPECTION AS PER QSI 038 OR LPI AS PER ASTM 1417 LEVEL 2	Firmed	-	3/29/19	1 pcs	0 pcs	1 pcs	\$198.33333/pcs	\$198.33
190173				Firmed	-	3/29/19	1 pcs	0 pcs	1 pcs	\$198.33333/pcs	\$198.33
Sub Total:							2	0	2		\$396.67



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

PURCHASE ORDER

PO043007



Items

Line Item	Job	Part	Description	Status	Account	Due Date	Order Quantity	Received Quantity	Balance	Unit Price (CAD)	Extended Price
3	191403	D212-664-101	Fwd Crosstube - High : TC STC SH01-9 Issue 3, FAA STC SR01298NY 09/01/08, EASA STC EASA.IM.R.S.01304 07/03/06, DGAC MEXICO STC IA-316/2015 15/06/17 *** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE*** Liquid Penetrant Inspection as per QSI 038 LPI as per ASTM 1417 Level 2 Attach copy of NDT results to work order	Firmed	-	3/29/19	1 pcs	0 pcs	1 pcs	\$198.3333/pcs	\$198.33
	191405			Firmed	-	3/29/19	1 pcs	0 pcs	1 pcs	\$198.3333/pcs	\$198.33
	191406			Firmed	-	3/29/19	1 pcs	0 pcs	1 pcs	\$198.3333/pcs	\$198.33
Sub Total:							3	0	3		\$595.00

Grand Total: \$1,190.00

Order Notes

Procurement Quality Clauses

- A005 right of entry
- A012 chemical and physical test report
- A016 personnel qualification
- A017 raw material identification (as applicable)

A022 Apical Processing

- A024 process certifications
- A026 certification of material conformance

A041 quality management system

- A042 dart notification by supplier
- A043 retention of quality documents

A048 counterfeit parts avoidance, detection, mitigation and disposition program

A049 supplier awareness

Terms & Condition of Purchasing(Suppliers) and Procurement Quality Clauses are an integral part of our AS9100 requirements. To learn in detail, please visit www.dartaerospace.com for further explanation.

Plex 3/28/19 3:19 PM dart.lavoie.chantal

**skyservice****Work Order Traveler**

Sky Service F.B.O. Inc.

10105 Ryan Avenue, Dorval, Quebec, H9P 1A2

TCCA AMO 53-89 / EASA 145.7142 / BDA AMO 385

WO #: MWO39775	Customer: Dart Aerospace Ltd.	Dept: NDT YUL	Reference: PO043007 ✓
Descr:	PN:	S/N:	Qty: 1
Make:	Model:	Reg:	A/C S/N:
TSN:	CSN:	TSO:	
Task: UNSCHEDULED			Sequence: 1

Work Required:**CARRY OUT NDT ON:**

- ✓ 1 FUEL TANK ASSY , P/N# D4464-041 , J/S# 184180 ✓
- ✓ 2 AFT CROSSTUBES , P/N# D212-664-201 , J/S# 190172 , 190173 ✓
- ✓ 3 FWD CROSSTUBES , P/N# D212-664-101 , J/S# 191403 , 191405 , 191406 ✓

DAS
63
9-89

Action Taken:						Date:	Initial/Stamp:
LPI C/O IAW ASTM E-1417M-16						MAR 28 2019	
NO CRACK OR LEAK FOUND							
PEN. ZL-56, MPO13600, CLEANER SKC-S MPO13923 , DEV. MPO11715 , UV LIGHT M-20142							
Description	Location	P/N	Qty	Batch	S/N Off	S/N On	

I certified that the maintenance described above has been performed in accordance with the applicable standard of airworthiness.

Signature:	ACA/SCA Stamp	Date:
Name: RAPHAEL MELIKIAN		MAR 28 2019

Entered: LL Date: Oct 24/14



NCR No. 19-7534

WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

Route update only

Job: <u>19140</u>	DISPOSITION		DEPARTMENT/PROCESS			
Part No. <u>D212-664-101</u>	Rework ☒	Skid-tube ☐	Cross tube ☐	Eng. (Non-AW) ☐	Engineering ☐	
	Scrap ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Water Jet ☐	
	Use-as-is ☐	Large Fab ☐	Finishing ☒	Rec/Store/Packaging ☐	Supplier ☐	
					Quality ☐	
Date: <u>APR 22 2019</u>	Sequence #:	QTY Affected: <u>1</u>		MRB (QSI042)		
Description Work Order Deviation		Disposition		Completed By		
- PART PAINTED WITHOUT "VIEWING WINDOW".		- STRIP AND RE-PAINT AS PER QSI 5.		<u>AS 19-4-22</u>		
		Primer 5143304 clear 5151467 Paint 5155827		Lead hand / Supervisor		
DAS 68 9-89				<u>19-07-18</u>		
Root Cause		QC / QA Coordinator				
Operator ☒	Pressure/Forced	Contamination	Power Loss/Surge	Positioned Wrong		
Manufacturing Process ☐	Bending	Misaligned/off center	Folio/Program	Outside Tolerance		
Equip/Tooling ☐	Crushing	BOM/Route	Grain Direction	Drawing		
Handling/Preservation ☐	Cracks	Broken/Damage/Defect	Weld	☒ Finish		
Material ☐	Crimp/Kink/Ripple/Wave/Twist	Incomplete/Unclear Instructions	Wrong Stock Pulled	Part Lost/Missing		
Product Improvement ☐	Marks/Chatter	Drill Holes	Out of Sequence	Misread		
Process Improvement ☐	Mislabeled	Fit/Function	Off-set/Set-up			
Human Factors ☐	Other/Details:					